 



CONNECTOR TYPE OSSM BULKHEAD FEEDTHROUGH CABLE JACK DIRECT SOLDER ATTACHMENT	CABLE TYPE .085 SEMI-RIGID COAXIAL CABLE	TOOLS REQUIRED: FIXTURE BASE: 2098-5206-54(T-4567) CLAMP INSERT: 2098-5208-54(T-4700-2) CENTER CONTACT HOLDER: 2098-5231-30(T-4579) SOLDER GAUGE: 2098-5212-02(T-4562-1) LOCATOR TOOL: 2098-5232-02(T-4570) DIELECTRIC INSERT TOOL: 2098-5233-02(T-4556)
--	---	--

### CONNECTOR




### ASSEMBLY OPERATIONS


- 1.0 PREPARATION OF CABLE**
- 1.1 INSERT SQUARED CABLE END INTO FIXTURE BASE HOLE PATTERN #2.
  - 1.2 PLACE SAW IN SAW SLOT AND CUT THROUGH OUTER CONDUCTOR AND INTO DIELECTRIC WHILE ROTATING CABLE.
  - 1.3 REMOVE CABLE FROM FIXTURE AND FINISH CUTTING DIELECTRIC WITH CUTTING BLADE.
  - 1.4 BARE INNER CONDUCTOR BY PRYING CUT OUTER CONDUCTOR AND DIELECTRIC FROM CABLE.
  - 1.5 COMPLETE TRIMMING OF CABLE INNER CONDUCTOR TO DIMENSION SHOWN.

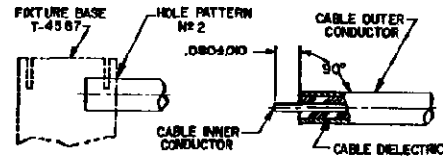


- 2.0 SOLDERING OF CENTER CONTACT TO CABLE INNER CONDUCTOR**
- 2.1 TIN INNER CONDUCTOR OF CABLE.
  - 2.2 PLACE SOLDER GAUGE ON INNER CONDUCTOR, FLUSH WITH END OF OUTER CONDUCTOR.
  - 2.3 PLACE CENTER CONTACT IN HOLDER, HEAT CENTER CONTACT AND PUSH IT OVER INNER CONDUCTOR OF CABLE TO REST FIRMLY AGAINST SOLDER GAUGE.
  - 2.4 REMOVE SOLDER GAUGE AND EXCESS SOLDER.

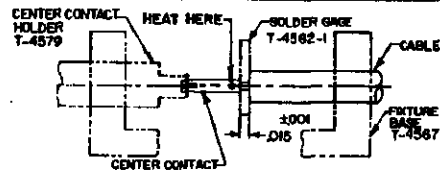

- 3.0 SOLDERING OF CABLE TO HOUSING**
- 3.1 PLACE CONNECTOR HOUSING ON END OF CABLE SUB-ASSEMBLY.
  - 3.2 PLACE LOOSE ASSEMBLY IN FIXTURE BASE AS SHOWN.
    - 3.2.1 NEST CENTER CONTACT IN LOCATOR TOOL.
    - 3.2.2 TIGHTEN CLAMP SCREW TO SECURE CABLE.
    - 3.2.3 TIGHTEN LOCATOR TOOL TO SEAT CABLE FIRMLY.
  - 3.3 SLIDE HOUSING OVER LOCATOR TOOL.
  - 3.4 MAINTAIN POSITION OF HOUSING FIRMLY AGAINST LOCATOR TOOL AND SOLDER.
- NOTE: FIXTURE SHOULD BE CLAMPED VERTICALLY IN VISE TO KEEP HOUSING SEATED AGAINST LOCATOR TOOL.

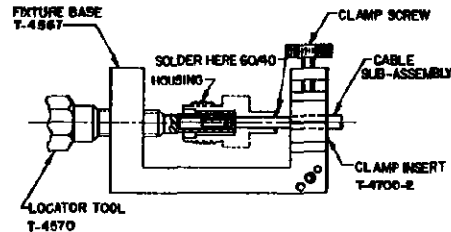

- 4.0 PRESSING OF DIELECTRIC BUSHING INTO HOUSING SUB-ASSEMBLY**
- 4.1 THREAD INSERT TOOL ONTO HOUSING SUB-ASSEMBLY.
  - 4.2 INSERT DIELECTRIC INTO INSERT TOOL HOUSING.
  - 4.3 PLACE INSERT TOOL PLUNGER INTO POSITION AND PRESS UNTIL FLANGE BOTTOMS ON TOOL HOUSING.
  - 4.4 ASSEMBLY IS NOW COMPLETE.

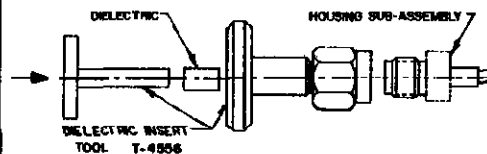

- 5.0 INSPECTION OF COMPLETED CONNECTOR ASSEMBLY**
- 5.1 ADHERENCE TO STEPS GIVEN WILL YIELD TOLERANCES SHOWN.

