


te.com



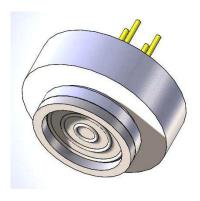

#### **Features**

- Weldable, Optional Process Fittings
- ±0.25% Pressure Nonlinearity
- Solid State Reliability
- Low Power

## **Applications**

- Hydraulic Controls
- Process Control
- Robotics
- Oceanography
- Refrigeration/Compressors
- Pressure Transmitters

# **87N** Uncompensated

## **Specifications**

- 316L SS Pressure Sensor
- High Performance, Small Profile
- 0-100 mV Output
- Absolute and Sealed Gage

This is a micro machined piezoresistive silicon pressure sensor.

It is designed for OEM applications where compatibility with corrosive media must be maintained. The sensor chip is mounted in a 316L stainless steel package, sealing a small volume of silicon oil between the diaphragm and the sensor chip.

The ISO pressure housing utilizes the oil column to couple the piezo-resistive sensor to the isolation diaphragm.

A variety of threaded process fittings are available. Fittings include standards like 1/4 and 1/8 NPT as well as custom process fittings.

## **Standard Ranges**

Range	Psi A	Psi S
0 to 1000	•	•
0 to 3000	•	•
0 to 5000	•	•

## **Performance Specifications**

Unless otherwise specified: Supply Current: 1.5mA, Ambient Temperature: 25°C

PARAMETERS	MIN	TYP	MAX	UNITS	NOTES
Sensitivity	15	22	28	mV/V@Span	
Zero Pressure Output	-4.0	0	+4.0	mV/V	1
Pressure Non-Linearity	-0.25	-	+0.25	%Span	2
Pressure Hysteresis	-	±0.05	-	%Span	
Repeatability	-	±0.02	-	%Span	
Bridge Resistance	3.9	4.5	5.1	ΚΩ	
Thermal Hysteresis – Span	-0.25	±0.05	+0.25	%Span	3
Thermal Hysteresis – Offset	-0.25	±0.05	+0.25	%Span	3
Temp Coefficient - Resistance	1.30K	1.51K	1.75K	PPM/°C	3
Temp Coefficient - Span	-1.45K	-1.25K	-1.0K	PPM/°C	3
Temp Coefficient - Offset	-	2	-	μV/V/°C	3
Long Term Stability – Span	-	±0.1	-	%Span/Year	
Long Term Stability – Offset	-	±0.1	-	%Span/Year	
Supply Current	0.5	1.5	2.0	mA	
Supply Voltage	-	5	9.5	V	
Output Load Resistance	5	-	-	MΩ	4
Insulation Resistance (50VDC)	50	-	-	ΜΩ	5
Pressure Overload	-	-	3X	Rated	6
Pressure Burst	-	-	4X	Rated	7
Operating Temperature	-40	-	+125	°C	
Storage Temperature	-50	-	+125	°C	

Media - Reference Port

LIQUIDS AND GASES COMPATIBLE WITH 316/316L ST STL


#### Notes:

- Measured at vacuum for absolute (A) and ambient for sealed gage (S).
- Best fit straight line
- Over temperature range -20°C to +85°C, with respect to +25°C. 3.
- Load resistance to reduce measurement errors due to output loading.
- Between case and sensing element. 5.
- Pressure overload 3x or 15,000 psi, whichever is less.
  - The maximum pressure that can be applied without changing the transducer's performance or accuracy. Pressure burst 4x or 15,000 psi, whichever is less.
- 7.
- The maximum pressure that can be applied to a transducer without rupture of either the sensing element or transducer.
- Testing: 8.
  - All 3000, 5000 parts are tested at 2500 psi and calculated to full scale pressure respective.
- Marking: 9.
  - Parts are marked with model number, pressure range, type ("A" for absolute or "S" for sealed gage),
  - Lot number, serial number and date code.
- Direct mechanical contact with diaphragm is prohibited. Diaphragm surface must remain free of defects (scratches, punctures, fingerprints, etc.) for device to operate properly. Caution is advised when handling parts with exposed diaphragms. Use protective cap whenever devices are not in use.

# **Dimensions**

(DIMENSIONS ARE IN INCHES [mm])

## w/Back End Options

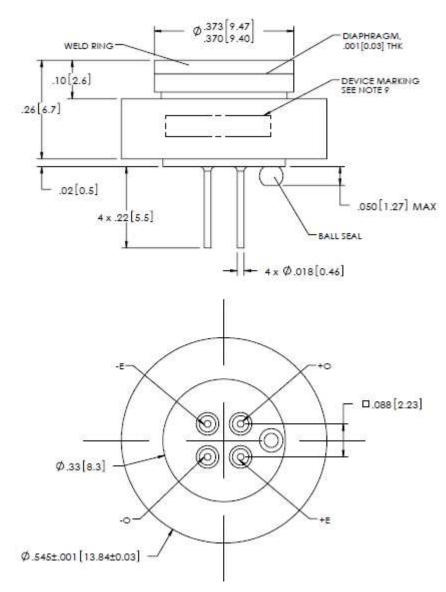

# w/Process Fitting Options


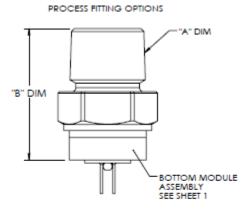


TABLE1: MODEL w/ FITTING DIMENSION				
FITTING TYPE	MEAS P/N	"A" DIM	"B" DIM	"C" DIM
1	041-7053	1/4-18 NPT	1.16[29.5]	7/8 [22.2] HEX
2	041-7052	1/8-27 NPT	1.15[29.0]	7/8 [22.2] HEX
3	041-7051	7/16-20 UNF-2A	1.00[25.4]	7/8 [22.2] HEX
4	041-6703	1/4-18 NPT	.93[23.6]	5/8 [15.9] HEX
5	041-5024	1/4-19 BSP	.98[24.9]	3/4 [19.0] HEX
8	041-6789	1/8-27 NPT	.80[20.3]	5/8 [15.9] HEX
9	041-7125	1/4-19 BSP	1.12[28.4]	7/8 [22.2] HEX
NOTE : FITTING TYPE "4" ASSEMBLY SHOWN ALL DIMS ARE FOR REFERENCE ONLY				



# **Equivalent Schematic**

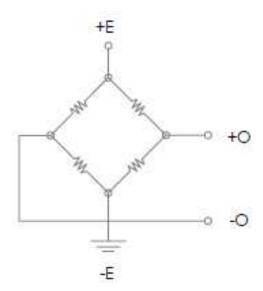

#### **ORDERING INFORMATION**



Pressure Range (PSI)
1000
3000
5000

Туре	
A = Absolute	
S = Sealed Gage	

Electrical	
L = Leads	

Fitting Type
0= No Fitting
1 = 1/4 NPT, 7/8 HEX
2 = 1/8 NPT, 7/8 HEX
3 = 7/16 UNF, 7/8 HEX
4 = 1/4 NPT, 5/8 HEX
5 = 1/4 BSP, 3/4 HEX
8 = 1/8 NPT, 5/8 HEX
9 = 1/4 BSP, 7/8 HEX

#### **NORTH AMERICA**

Measurement Specialties, Inc., a TE Connectivity Company Tel: 800-522-6752

Email: customercare.frmt@te.com

#### **EUROPE**

Measurement Specialties (Europe), Ltd., a TE Connectivity Company Tel: 800-440-5100

Email: customercare.lcsb@te.com

### **ASIA**

Measurement Specialties (China), Ltd., a TE Connectivity Company Tel: 0400-820-6015

Email: customercare.shzn@te.com

## te.com

TE Connectivity, TE, TE Connectivity (logo) and Every Connection Counts are trademarks. All other logos, products and/or company names referred to herein might be trademarks of their respective owners

The information given herein, including drawings, illustrations and schematics which are intended for illustration purposes only, is believed to be reliable. However, TE Connectivity makes no warranties as to its accuracy or completeness and disclaims any liability in connection with its use. TE Connectivity's obligations shall only be as set forth in TE Connectivity's Standard Terms and Conditions of Sale for this product and in no case will TE Connectivity be liable for any incidental, indirect or consequential damages arising out of the sale, resale, use or misuse of the product. Users of TE Connectivity products should make their own evaluation to determine the suitability of each such product for the specific application.

© 2019 TE Connectivity Corporation. All Rights Reserved.

Version # 08/2020

